


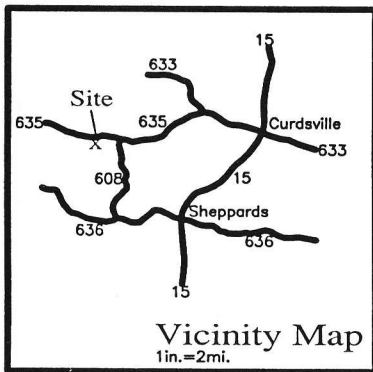


Legend:
 —E—=Overhead electric line(s)
 NDL =New Division Line

TM188-9
 Jeanne Ann Lynch
 D.B.200 p.538
 Plat D.B.14 p.68

State Route No. 635

Buckingham Springs Road
 50'R/W D.B.230 p.675

±0.46mi. To
 Rte. 608

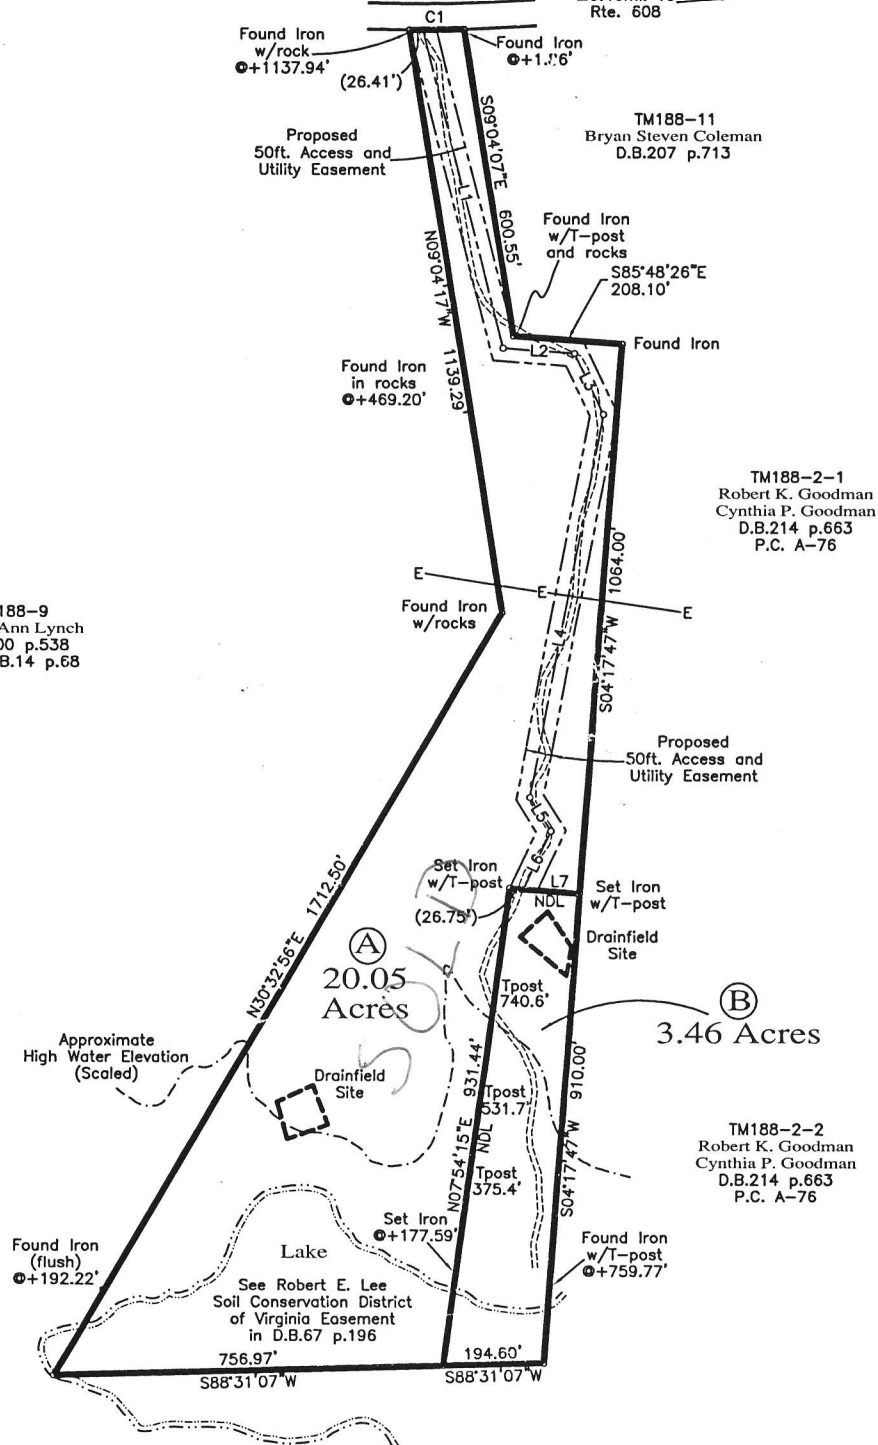

CURVE	RADIUS	ARC LENGTH	CHORD LENGTH	CHORD BEARING	DELTA ANGLE
C1	3258.01'	106.15'	106.15'	N89°12'27"E	1°52'01"

LINE	BEARING	DISTANCE
L1	S14°05'58"E	634.33'
L2	S85°48'26"E	137.11'
L3	S25°11'35"E	129.61'
L4	S10°44'44"W	752.95'
L5	S32°06'36"E	77.01'
L6	S25°09'48"W	123.99'
L7	S85°42'13"E	135.00'



Notes:

1. Tax Map Parcel No.188-10.
2. This plat has been prepared without the benefit of a title examination and therefore does not necessarily indicate all encumbrances on the property.
3. This plat agrees with found plats, deed descriptions, ground evidence and local witnesses as near as possible.
4. This plat is based on a current field survey.


REDUCED

Division of Tax Parcel No.188-10

Current Owner: Larry D. Atkins D.B.419 p.396
 See Plat Cabinet A Slide 241E

Francisco District, Buckingham County, Virginia
 November 21, 2014

Scale: 1in.=200ft.



Maxey & Associates, P.C.

Land Surveyors • Engineers • Planners • Consultants
 P.O. Box 90 • Farmville • Virginia • 23901 • Tel:434-392-8827

14S0148
 FB1194-06