

SS - 177
Rev 3/04

West Virginia Department of Health & Human Resources
Grant County Department of Health

Permit # ST-14120027
Tax Map Name: _____
Map # 430 Parcel # 21
County Road: 220/1
Coordinates: N _____ W _____
ON-SITE SEWAGE DISPOSAL SYSTEM
INSPECTION REPORT

Name of Owner: Petry, Roger Installer: Prochazka, Darren
Address: 171 Currency Drive; Bunker Hill, WV 25413 297 Patience Way; Martinsburg, WV 254
Property Location: Wilton Orchard Road, Orchard View Estates Subdivision, Lot #4
Type of Facility: Residence Facility is: New ☒ Existing ☐ Lot Size (ft²/acres): 2.06
Design Loading in gpd/No. Bedrooms: 4 Source of Water Supply: Public


SEWAGE TANK COMPONENT

Capacity in Gallons: 1000 Material: Concrete Manufacturer: Behr
Distance (ft) of System to: Dwelling: 36 Private ☐ Public ☒ Water Source: 100 Property Line: 20

ON-SITE DISPOSAL SYSTEM

Class I System: Standard Soil Absorption Trenches ☐ or Bed ☐ Gravelless Pipe ☐ Diameter: _____ Inches
Chamber Soil Absorption Trenches ☒ or Bed ☐
Class II System: Pumped/Dosed Soil Absorption Trenches ☐ or Bed ☐ Evapotranspiration Trenches ☐ or Bed ☐
Shallow Soil Absorption Trenches ☐ or Bed ☐ Other: _____
No. of Lines: 4 Length (in feet) of Each: 80, 80, 80, 80
Width of Trenches: 36 inches/feet. Depth to Bottom of Field: 24 inches.
If Bed, Dimensions: _____ feet. If Chamber System, Name: Intercept, No. of Units: 80
Approved & Adequate Materials Used? Yes ☒ No ☐ Size Equates to: 1600 Sq. Ft. of Standard Field
Distance (ft) of System to: Dwelling: 61 Private ☐ Public ☒ Water Source: 100 Property Line: 20
Remarks: _____

Sketch of Installation with Triangulation or Distance to Specific Landmarks:

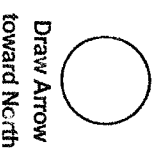

An inspection indicates that the sewage disposal system described above
DOES MEET ☒,
DOES NOT MEET ☐,
CANNOT BE DETERMINED TO MEET ☐ the minimum standards established by the West Virginia Bureau for Public Health.

To correct a health hazard, modifications to existing systems may be done to improve part of a system. Such modifications may not be able to be designated as a does meet system since inadequate information is known.

Although many factors contribute to the successful functioning of a sewage disposal system, this office recommends water conservation and maintaining an even usage of water throughout the week.

Visit Date(s): _____
Final Inspection Date: 12-4-2012

Sanitarian: Cullen Shorman