

IDAHO DEPARTMENT OF WATER RESOURCES
WELL DRILLER'S REPORT

(3)

1. WELL TAG NO. D 0088272

Drilling Permit No. _____

Water right or injection well # _____

2. OWNER: _____

Name MAGEE LLC.Address 435 WOODVIEW RD.City SANDPOINT State ID Zip 83864

3. WELL LOCATION: _____

Twp 54 North ☒ or South ☐ Rge. 4 East ☐ or West ☒Sec 10 1/4 NW 1/4 SW 1/4County BONNERLat 48 ° 2.4174 (Deg. and Decimal minutes)Long -116 ° 29.6672 (Deg. and Decimal minutes)Address of Well Site SAWBUCK ROADCity PIEST RIVERLot 3 Blk. _____ Sub. Name SAWBUCK ESTATES

4. USE: _____

☒ Domestic ☐ Municipal ☐ Monitor ☐ Irrigation ☐ Thermal ☐ Injection☐ Other _____

5. TYPE OF WORK: _____

☒ New well ☐ Replacement well ☐ Modify existing well☐ Abandonment ☐ Other _____

6. DRILL METHOD: _____

☒ Air Rotary ☐ Mud Rotary ☐ Cable ☐ Other _____

7. SEALING PROCEDURES: _____

Seal material From (ft) To (ft) Quantity (lbs or ft³) Placement method/procedureBENTONITE 0 18 500 LBS. OVERBORECHIP _____ DRY POUR

8. CASING/LINER: _____

Diameter (nominal) From (ft) To (ft) Gauge or Schedule Material Casing Liner Threaded Welded

6 1.5 179 .250 STEEL ☒ ☐ ☐ ☒☐ ☐ ☐ ☐☐ ☐ ☐ ☐☐ ☐ ☐ ☐Has drive shoe used? ☒ Y ☐ N Shoe Depth(s) 179'9. PERFORATIONS/SCREENS: 179' @ 180'Perforations ☒ Y ☐ N Method AIR PERFORATORManufactured screen ☐ Y ☒ N Type _____

Method of installation _____

From (ft) To (ft) Slot size Number/ft Diameter (nominal) Material Gauge or Schedule

179 169 1/16 x 1" 48 6 STEEL .250"☐ ☐ ☐ ☐ ☐ ☐☐ ☐ ☐ ☐ ☐ ☐☐ ☐ ☐ ☐ ☐ ☐

Length of Headpipe _____ Length of Tailpipe _____

Packer ☐ Y ☒ N Type _____

10. FILTER PACK: _____

Filter Material From (ft) To (ft) Quantity (lbs or ft³) Placement method☐ ☐ ☐ ☐ ☐ ☐☐ ☐ ☐ ☐ ☐ ☐☐ ☐ ☐ ☐ ☐ ☐

11. FLOWING ARTESIAN: _____

Flowing Artesian? ☐ Y ☒ N Artesian Pressure (PSIG) _____

Describe control device _____

12. STATIC WATER LEVEL and WELL TESTS:

Depth first water encountered (ft) 150 Static water level (ft) 150Water temp. (°F) COLD Bottom hole temp. (°F) COLDDescribe access port WELDED PLATE

Well test: _____ Test method: _____

Drawdown (feet) Discharge or yield (gpm) Test duration (minutes) Pump Bailer Air Flowing artesian

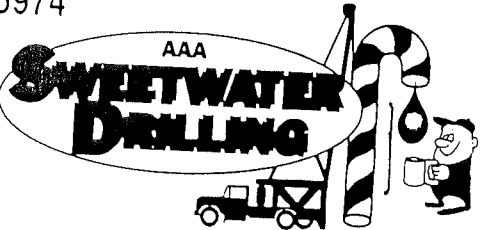
180 35 60 ☐ ☐ ☒ ☐☐ ☐ ☐ ☐Water quality test or comments: GOOD

13. LITHOLOGIC LOG and/or repairs or abandonment:

Bore Dia. (in) From (ft) To (ft) Remarks, lithology or description of repairs or abandonment, water temp. Water Y N

10 0 1 TOP SOIL ☐ ☐1 6 LOOSE SAND, CLAY, COBBLES ☐ ☐6 9 BOULDER ☐ ☐9 18 LOOSE SAND, CLAY, COBBLES ☐ ☐8 18 21 ☐ ☐21 42 COARSE SAND & BOULDERS ☐ ☐42 91 CEMENTED SAND, GRAVEL, CLAY ☐ ☐91 96 BOULDER ☐ ☐96 150 CEMENTED SAND, GRAVEL, CLAY ☐ ☐150 180 PEA GRAVEL, WATER ☐ ☐

208-263-5974

Mark Pitts
Robin PittsServing
North Idaho
Over 20 YearsDRILLING • PUMPS • WATER TREATMENT
Complete Systems • From the Well To The House
435 Woodview Rd. • Sandpoint, ID 83864Completed Depth (Measurable): 180'Date Started: 6/18/21 Date Completed: 6/21/21

14. DRILLER'S CERTIFICATION:

I/We certify that all minimum well construction standards were complied with at the time the rig was removed.

Company Name AAA SWEETWATER DRILLING Co. No. 509Principal Driller Mark Pitts Date 6-24-21Driller [Signature] Date 6/22/21

Operator II _____ Date _____

Operator I _____ Date _____

Operator I _____ Date _____

Operator I _____ Date _____

Operator I _____ Date _____

Operator I _____ Date _____

Operator I _____ Date _____

Operator I _____ Date _____

Operator I _____ Date _____